

Fig. 19 Loads applied to the bearers due to collision of the blanket cylinders in way of the pits. Bearer marks occur not only in way of the blanket cylinder pits but simultaneously at points of contact of the bearers of the top and bottom plate and blanket cylinders.

Fig. 20 After the cylinders have turned 153° from the zero position shown in Fig. 19, the pits of the bottom plate and blanket cylinders meet, which in turn gives rise to marks on both bearers between both blanket cylinders and top plate and blanket cylinders.

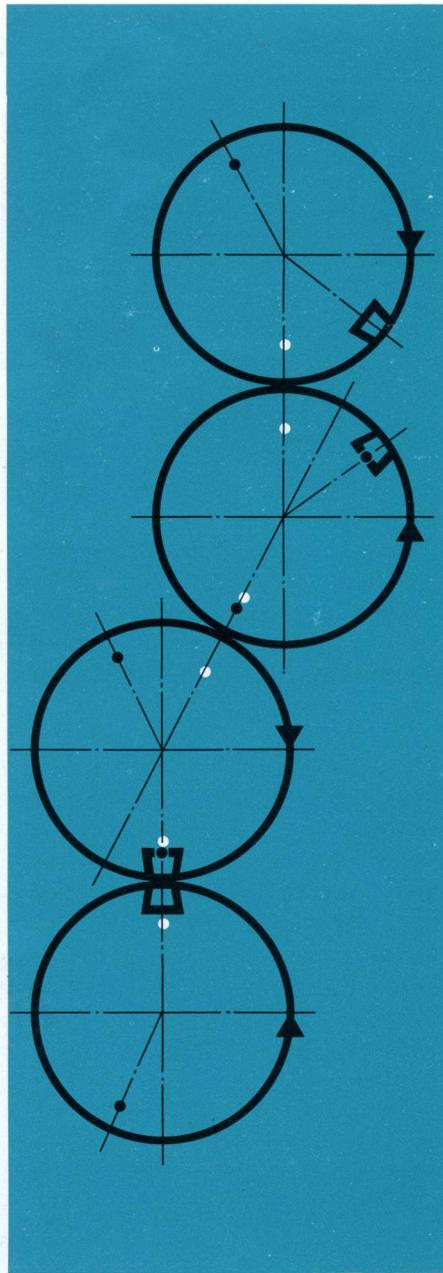
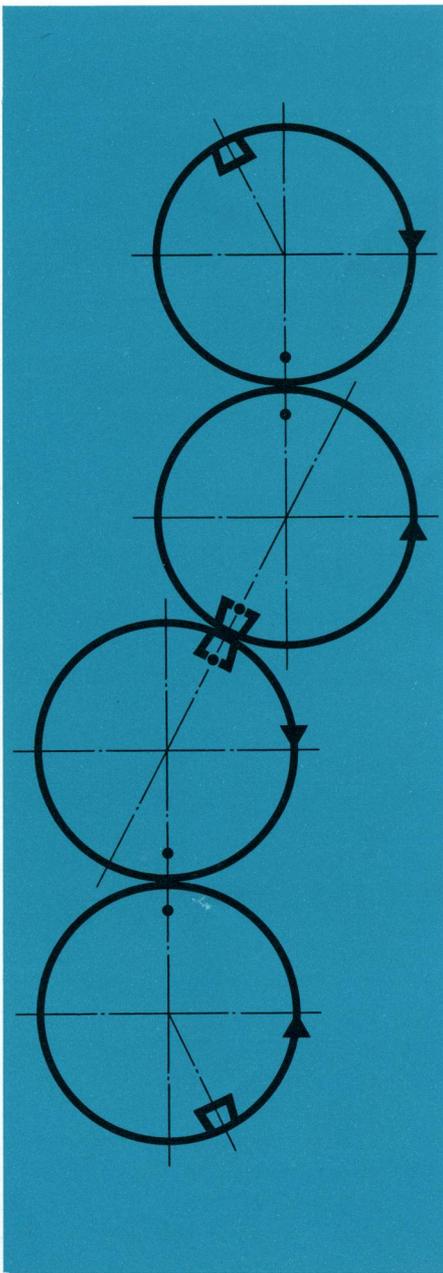


Fig. 19

Fig. 20